Temposonics®

Magnetostrictive, Absolute, Non-contact Linear-Position Sensors




Document Part Number 551119 Revision C

MH-Series Mobile Hydraulic in-Cylinder Sensor

Model MH PWM Output

Data Sheet

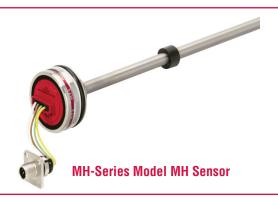



Cylinder Application Example

FEATURES

- Linear, Absolute Measurement in Hydraulic Cylinders
- Non-Contact Sensing Technology
- Superior Accuracy, $< \pm 0.04\%$ F.S.
- Hysteresis < ± 0.1 mm</p>
- Repeatability, < ± 0.005% F.S.
- **■** Compact Design for Embedded Cylinder Applications
- PWM Output:

Selectable frequency: 50 to 500 Hz Scaling: 5% to 95%, 25% to 75%

- Stroke length: 50 mm (2 in.) to 2500 mm (98 in.)
- Voltage input: 12/24 Vdc
- Shock Rating: 100 g (single hit) / IEC 68-2-27
 Vibration Rating 25 g / 10-2000 Hz/IEC 68-2-6
- 200 V/m EMI Immunity

BENEFITS

- Rugged Mobile Sensor
- Direct PWM Output (Fully reversible)

APPLICATIONS

- **■** Continuous Operation In Harsh Mobile Conditions
- High Pressure Conditions
- **■** For Welded and Tie-rod Cylinder Applications

TYPICAL INDUSTRIES

- **■** Construction
- Agriculture
- Off-highway Machinery

Product overview

The MH-Series Model MH sensor is designed with the "mobile" world in mind. The Model MH sensor is validated in the field by customers worldwide. Performance is second-to-none with high EMI resistance of 200 V/m. Ruggedness is "designed in"; 100 g shock and 25 g vibration rating. The model MH PWM sensor can be fully sealed and embedded in a cylinder to ensure a long operating life. Direct connection to the Temposonics® M12x1 connector system and other proven mobile connectors are available.

Product Specifications and Output

Product specifications

Parameters	Specifications	Parameters	Specifications		
OUTPUT		ENVIRONMENT	AL		
Measured variable:	Linear Position measurement	Operating conditions:	Operating: -40 °C (-40 °F) to +105 °C (221 °F) Storage: -30 °C (-22 °F) to +105 °C (221 °F)		
Output:	Direct PWM: Displacement Scaling: 5% to 95%, 10% to 90%, 15% to 85%, 20% to 80%, 25% to 75% Frequency (Hz): 50, 60, 100, 200, 300, 400 and 500	EMC test:	90% relative humidity, no condensation 200 V/m: ISO 11452-5 ISO 14982 - Agriculture and forest machinery		
	Consistent: ≤ ± 0.1 mm Signal output frequency: PWM adjustable 1 ms to 65 ms	Shock rating:	100 g (single hit)/IEC standard 68-2-27 (survivability) 25 g / 10 to 2000 Hz /IEC standard 68-2-6		
Stroke length:	50 mm to 2500 mm (2 in. to 98 in.)	Vibration rating:	Sensor rod, 10 mm (0.39 in.): 25 g Sensor rod, 7 mm (0.27 in.): 15 g		
	Measured in 5 mm (0.20 in.) increments	WIRING			
Linearity uncorrected:	50 to 2500 mm ≤± 0.1 mm 255 to 2000 mm < ± 0.04% full stroke (minimum ± 0.100 mm 0.003 in.)	Connection type:	One 4-wire with the M12 x 1 connector and flange (provides IP69K environmental protection when installed in a cylinder).		
	<pre>< ± 0.08% full stroke (for short damping zone) 500 mm ≤± 0.2 mm 750 mm ≤± 0.3 mm 1250 mm ≤± 0.5 mm 2005 to 2500 mm ≤± 0.8 mm</pre>	ROD STYLE SENSOR (Model MH)			
		Material:	Sensor rod: Stainless steel 1.4306 / AISI 304L Housing: Stainless steel 1.4305 / AISI 303 Mechanical assembly: Flange housing 48 mm		
Repeatability:	< ± 0.005% of full stroke		(1.89 in.) dia., O-ring 40.87 x 3.53 mm NBR		
Hysteresis:	± 0.1 mm (0.003 in.)		80, backup ring 42.6 x 48 x 1.4 PTFE		
Cycle time:	2 ms	Sealing:	IP67 (IP69k when installed inside a cylinder with M12 x 1 in. connection type)		
Setpoint tolerance:	± 0.2 mm (0.007 in.)	Pressure rating:	Sensor rod, 10 mm (0.39 in.):		
Operating voltage:	12/24 Vdc (8-32 Vdc)	-	Operating, 350 bar (5076 psi) Peak, 530 bar (7687 psi)		
Power drain:	1 W		Sensor rod, 7 mm (0.27 in.):		
ELECTRONICS			Operating, 300 bar (4350 psi)		
Electrical isolation:	500 Vdc (DC ground to machine ground)	Magnet type:	Peak, 400 bar (5800 psi) Ring magnet (See standard magnet selections)		
Polarity protection:	Up to -36 Vdc				
Overvoltage protection:	Up to 36 Vdc				

Output options

The MH-Series Model MH position PWM sensor provides consistent resolution with a adjustable signal output frequency of 1 to 65 ms.

MTS Sensors

Model MH sensor dimension references

Model MH, rod-style Sensor Drawing is for reference only, contact applications engineering for tolerance specific information.

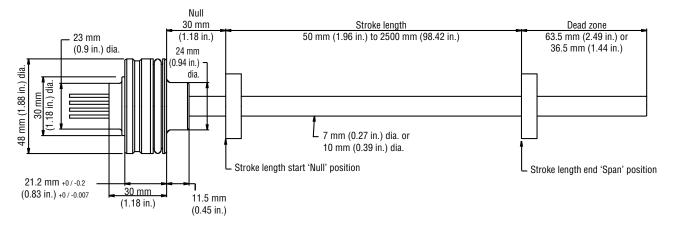


Figure 1. MH-Series Model MH rod-style sensor dimension reference

Standard magnet selections (Model MH)

SELECTION OF POSITION MAGNETS (MAGNET AND MAGNET SPACER MUST BE ORDERED SEPARATELY)

A choice of three magnets are available with the Model MH rod-style sensor. Magnets must be ordered separately with Model MH position sensors. The standard ring magnet (part number 201542-2) is suitable for most applications.

STANDARD RING MAGNET Part number 201542-2

MAGNET SPACER Part number 400633 (used with magnet part no.: 201542-2)

RING MAGNET Part number 400533

RING MAGNET Part number 401032





0.D.: 33 mm (1.3 in.) Thickness: 8 mm (0.3 in.) Operating temperature: - 40 °C (-40 °F) to - 105 °C to (221 °F)

Material: Non-ferrous Used with ring magnet (part no.: 201542-2)

I.D.: 14 mm (0.56 in.) **0.D.:** 32 mm (1.25 in.) Thickness: 3.2 mm (0.125 in.)

Material: Ferrite PA I.D.: 13.5 mm (0.53 in.) O.D.: 25.4 mm (1 in.) Thickness: 8 mm (0.3 in.) Operating temperature: - 40 °C (-40 °F) to - 105 °C to (221 °F)



Material: Ferrite PA I.D.: 13.5 mm (0.53 in.) **0.D.:** 17 mm (0.68 in.) Thickness: 8 mm (0.31 in.) Operating temperature: - 40 °C (-40 °F) to - 105 °C to (221 °F)

Model MH Rod-Style Sensor Installation

Model MH sensor installation references

The robust Temposonics Model MH sensor's new stainless-steel position sensor is designed for direct stroke measurement in mobile hydraulic cylinders. The Temposonics Model MH sensor can be installed from the head side or the rod side of the cylinder depending on the cylinder design.

Installation Notes:

- 1. Use a non-ferrous circlip to fix the magnet.
- 2. The piston rod bore is dependent on hydraulic pressure and piston velocity. Minimum drilling for a (10 mm rod) should be 13.5 mm.
- 3. There should be no less than 3 mm clearance between the end of the sensor rod and the bottom of the rod bore at full retraction.

Model MH, rod-style sensor mechanical installation Drawing is for reference only, contact applications engineering for tolerance specific information.

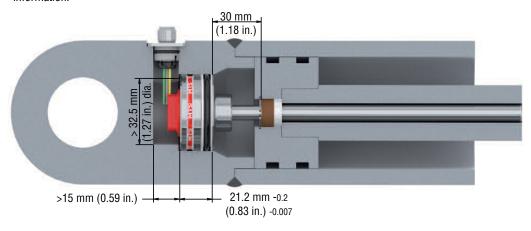


Figure 2. MH-Series Model MH rod-style sensor mechanical installation example

Model MH, rod-style sensor installation Drawings are for reference only, contact applications engineering for tolerance specific information.

Installation methods are possible in magnetic and non-magnetic applications (shown in *Figures 3 and 4*) and are entirely dependent on the cylinder design. While the most common method of installation is from the rod side of the cylinder, installation from the head side of the cylinder is also possible. In both installation methods, the sensor seals the cylinder by using an O-Ring and backup ring which is installed on the sensor housing.

Magnetic material installation reference




Figure 3. Model MH installation in magnetic material using a non-ferrous magnet spacer.

Non-magnetic material installation reference





Figure 4. Model MH installation in non-magnetic material without a non-ferrous magnet spacer.

Set screw detail

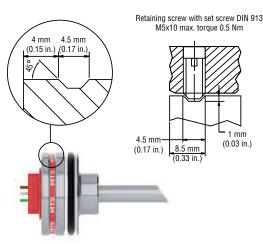


MTS Sensors 4

Connections and wiring

CONNECTION TYPE

The Temposonics® M12 connector system (shown in *Figures 7, 8, 9 and 10*), meets the most stringent protection requirements important for the difficult environmental conditions of mobile hydraulics applications. Protection type IP69K makes the robust metal housing not only completely dust and waterproof, even the harshest cleaning measures cannot damage the sensor.

Model MH, rod-style sensor connector and pin assignments Drawings are for reference only, contact applications engineering for tolerance specific information.

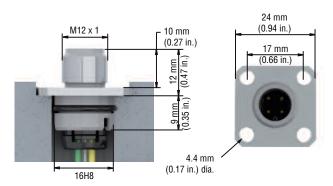

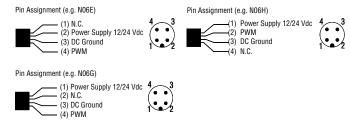


Figure 6. M12 x 1 connector system pin assignments

Figure 5. Model MH sensor connection dimensions

MOUNTING THE CONNECTOR SYSTEM TO THE CYLINDER

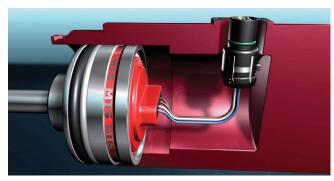


Figure 7. The MH sensor is delivered by MTS together with the new connector system: The connector insert carrier is already connected to the sensor electronics, i.e. no soldering, any color or connection mistake.



Figure 8. The connector insert is taken out of the cylinder through a bore hole. The flange housing can be snapped into position easily from outside.



Figure 9. Four standard screws must be tightened to mount the connector system on the cylinder.



Figure 10. With a corresponding mating molded plug the connector system fulfills a ingress rating of IP69K.

Model MH Rod-Style Sensor Ordering Information

MH-Series Model MH ordering information

Use the table below to configure your sensor part number.	
M H M M 3	
M 11	
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 1	6 17 18
SENSOR MODEL	M H 1-2
MH = Rod-style with pressure fit flange housing 48 mm (1.88 in.) dia.	
SENSOR STYLES ————————————————————————————————————	3
C = Rod-style 10 mm (0.39 in.) dia. F = Rod-style 7 mm (0.27 in.) dia.	
damping zone 63.5 mm (2.49 in.) Rod-style 7 mm (0.27 in.) dia.	
damping zone 63.5 mm (2.49 in.)	
E = Rod-style 10 mm (0.39 in.) dia. reduced damping zone 36.5 mm (1.44 in.)	
STROKE LENGTH (ORDER LENGTH)	M 4-8
M = Millimeters	
50 to 2500 mm (in 5 mm increments) CONNECTION TYPE = = = = = = = = = = = = = = = = = = =	9-12
<u>LLL</u>	9-12
N = Wire exit Integral 'single wires', Each conductor: 0.5 mm² (20 AWG)	
Termination type:	
N _ A = Pigtail (stripped conductors) no termination	
N _ E = 4 single wires, M12x1 IP69K, 4 pin (pin assignment 2-3-4)	
N _ G = 4 single wires, M12x1 IP69K, 4 pin (pin assignment 1-3-4)	
N _ H = 4 single wires, M12x1 IP69K, 4 pin (pin assignment 1-3-2)	
Wire length:	
06 = 60 mm (2.36 in.) min. wire length	
25 = 250 mm (9.84 in.) max. wire length	
Cable exit:	
4 conductor / cable; integral PUR cable, pigtailed, 4 cables, shielded. Cable length (first digit x 1m., second digit x 0.1 m.)	
10 = 1.0 m length (standard all other lengths require minimum order quantities; 0.5 m min. to 9.9 max.: 0.1 m increments).	
Termination type:	
A = Pigtail (stripped conductors) for wire termination, contact factory.	
INPUT VOLTAGE ————————————————————————————————————	3 13
3 = +12/24 Vdc	
OUTPUT=	14-16
P = PWM	
15 digit span range	
A = 5 to 95% D = 20 to 80%	
B = 10 to 90% E = 25 to 75%	
C = 15 to 85%	
16 digit Frequency	
A = 50 Hz	
C = 100 Hz	
D = 200 Hz X = Not defined	
POLARITY AND FAILURE OUTPUT OPTION = =	17-18
17 digit - Output polarity (Default 1)	
1 = See page 7 diagram 2 = See page 7 diagram 3 = See page 7 diagram 4 = See page 7 diagram	
18 digit - Failure output (Default H) H = Output high L = Output low M = Square wave	
H = Output high L = Output low M = Square wave	

MTS Sensors

Signal diagrams

Polarity and failure output options to complete order form digits 17 and 18 are listed below.

Digit 17 - Output polarity (Default = 1)

	Enter one of the o	ptions below for di	ait 17 for the	direction and	polarity	ı of the sid	unal:
--	--------------------	---------------------	----------------	---------------	----------	--------------	-------

1 = Measurement is from rising edge to falling edge, p	pulse width increases as magnet moves from head to tip (Default condition)
Magnet near head	←→
Magnet near tip	←
2 = Measurement is from falling edge to rising edge,	pulse width decreases as magnet moves from head to tip
Magnet near head	\
Magnet near tip	\longleftrightarrow
3 = Measurement is from rising edge to falling edge,	pulse width decreases as magnet moves from head to tip
Magnet near head	←
Magnet near tip	←→
4 = Measurement is from falling edge to rising edge,	pulse width increases as magnet moves from head to tip
Magnet near head	←→
Magnet near tip	←
Digit 18 - Failure output (Default = H) Enter one of the options below for digit 1	8 to describe the action taken if the sensor stops reading the magnet:
H = Output goes high (5 Vdc, default condition)	
L = Output goes low (0 Vdc)	
M = Output is a square wave, 50% duty cycle at 1/2 PWM frequency (Digit 15)	

Magnet selections and optional Test kit

Magnets and the MH-Series Analog/PWM tester must be ordered separately. Refer to the table below for ordering information.

Magnet selections	Part no.
Ring magnet, O.D. 17.4 mm (0.68 in.)	401032
Ring magnet, O.D. 25.4 mm (0.99 in.)	400533
Ring magnet, O.D. 33 mm (1.29 in.)	201542-2
Magnet spacer (use with magnet part no.: 201542-2)	400633

Optional accessory	Part no.
MH-Series Analog/PWM Test kit	280618
MH-Series Test kit contents:	
 MH-Series Analog/PWM Tester 	
 12 Vdc battery charger with 	
(adapter main plug North America, adapter	
main plug EU, or adapter main plug UK)	
 Cable with M12 x 1 connector 	
Cable with pigtailed wires	
Carrying case	
CD-Rom with user's guide	



MH-Series Analog/PWM Tester, part no.: 280618





Document Part Number: 551119, Revision C

FRANCE

Branch Office

Phone: +33 1 58 4390-28

UNITED STATES

MTS Systems Corporation Sensors Division Phone: +1 919 677-0100 E-Mail: info.us@mtssensors.com

GREAT BRITAIN

Branch Office Phone: +44 79 44 15 03 00 E-Mail: info.uk@mtssensors.com

GERMANY

MTS Sensor Technologie GmbH & Co. KG Phone: +49 2351 9587-0 E-Mail: info.de@mtssensors.com

CHINA

Branch Office Phone: +86 21 6485 5800

E-Mail: info.cn@mtssensors.com

ITALY

Branch Office Phone: +39 030 988 3819 E-Mail: info.it@mtssensors.com

JAPAN

Branch Office Phone: +81 42 707 7710 E-Mail: info.jp@mtssensors.com

www.mtssensors.com

E-Mail: info.fr@mtssensors.com